


This survey was done at the request of Jesse Hough, David City, Nebraska.

Note: All Bearings are referenced from True North observed at the Northwest Corner, Section 36, T17N, R18E.

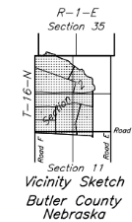

-Detail-

LINE	BEARING	DISTANCE
L1	N 11°56'56" E	33.16 M
L2	S 89°58'02" E	202.70 M
L3	N 56°17'40" E	212.35 M
L4	N 33°11'58" E	169.44 M
L5	S 49°28'07" E	195.78 M
L6	S 48°16'11" E	96.02 M
L7	S 19°29'02" E	31.70 M
L8	N 67°34'59" E	154.89 M
L9	S 40°42'41" E	203.77 M
L10	S 19°13'51" E	190.44 M
L11	S 42°47'06" E	248.45 M
L12	S 73°12'01" E	332.90 M
L13	S 41°47'06" E	248.45 M
L14	S 00°15'14" E	11.72 M
L15	S 42°20'02" E	10.52 M
L16	S 00°11'43" W	30.01 M
L17	S 00°11'43" W	368.53 M
L18	S 65°07'40" E	58.12 M
L19	S 65°07'40" E	99.44 M
L20	S 27°13'58" E	82.15 M
L21	S 33°28'07" E	79.79 M
L22	S 49°12'55" E	60.90 M
L23	S 72°49'42" E	38.04 M
L24	S 45°19'15" E	53.52 M
L25	S 23°14'27" W	168.00 M
L26	S 378.19 M	118.1 M
L27	S 82.79 M	77.7 M
L28	S 77.87 M	102.2 M
L29	S 114.74 M	166.86 M
L30	S 114.74 M	166.86 M
L31	S 166.86 M	166.86 M
L32	S 166.86 M	166.86 M

- Legend-
- Found Monument
 - A 5/8" rebar w/ plastic cap
 - B Iron pipe
 - Set 5/8" x 24" Rebar w/ Plastic Survey Cap
 - ⊕ Set Witness Corner
 - ⊕ Set 5/8" x 24" Rebar w/ PSC
 - ⊕ Found Witness Corner
 - ⊕ 5/8" Rebar w/ PSC
 - ▲ Computed Location
 - M Measured this Survey
 - D Deeded Measurement
 - R Recorded Measurement
 - R.A. Rytrom L.S. #241 (1982, Recorded Survey)
 - R1 Recorded Measurement
 - R.A. Rytrom L.S. #241 (1982, Unrecorded Survey)
 - J Recorded Measurement
 - J.A. McMeekin L.S. #165
 - T Recorded Measurement
 - T.A. Tremel L.S. #455
 - P Plat Measurement
 - General Land Office
 - A.E. Access Easement
 - P.O.B. Point of Beginning

Field Notes:
 Northwest Corner Government Lot 5, Section 2, T16N, R1E - found 2" iron shaft 8" deep as recorded by R.L. Runkler, L.S. #383 on January 18, 2018.
 Ties: 33.59' WNW to "x" nails in lone fence post
 30.47' WSW to "x" nails in lone fence post
 34.82' NNE to "x" nails in lone fence post
 14.75' East to centerline of Road E South

Southwest Corner Government Lot 4, Section 35, T17N, R1E - found 5/8" rebar with plastic survey cap stamped L.S. #455 as recorded by R.L. Runkler L.S. #383 on January 18, 2018.
 Ties: 35.54' NWN to spike in SW side of gate post
 33.74' NNE to "x" nails in East side of railroad gate post
 51.23' NW to "x" nails in fence post

Northwest Corner Tax Lot 7, Section 11 also known as Southwest Corner, Section 2, T16N, R1E - found 1 1/8" iron pipe as recorded by T.A. Tremel, L.S. #455 on December 24, 1996.
 Ties: 93.90' SSE to "x" nails in power pole
 122.22' South to North end of a concrete bridge deck
 36.30' SE to "x" nails in top of fence post
 44.93' NE to "x" nails in fence post
 On centerline of Road E & M

Meander Corner located on the Original South Bank of the Original Platte River and on the West line of Section 11, T16N, R1E - found 5/8" rod and aluminum cap 8" deep as recorded by T.A. Tremel, L.S. #455 on December 24, 1996.
 Ties: 42.89' SW to "x" nails in power pole
 65.52' SE to "x" nails in fence post
 48.90' NW to nail in disk in top of corner fence post
 54.20' NE to nail in disk in top of corner fence post
 10' North to centerline of Road 44 East

Meander Corner located on the Original South Bank of the Original Platte River and on the East line of Section 11, T16N, R1E - found 5/8" rebar 1" deep as recorded by T.A. Tremel, L.S. #455 on October 22, 1997.
 Ties: 101.72' SE to "x" nails in fence post
 63.35' West to NE corner of concrete bridge deck
 68.20' SW to nail in disk in power pole
 6' West to centerline of Road F South
 13' South to centerline of Road 44 on a curve

● Meander Corner on East line Section 11

